radwag.com

# H315.4.1500.H9 Stainless Steel Platform Scale

WP-232-0018

More information on the website
mirror.radwag.com/en/info,w1,7HM

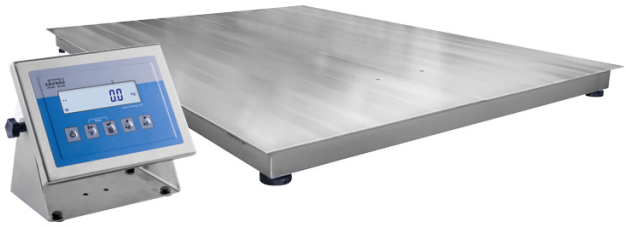

The drawings, photos and graphics used are for illustrative purposes only.

## Functions

- Plus/Minus Control
- Percent Weighing
- Totalizing
- Parts counting
- Internal battery
- Peak hold
- Newton unit measurement
- Animal weighing

## Datasheet

| Metrological parameters | |
|---|---|
| Maximum capacity [Max] | 1500 kg |
| Minimum load | 10 kg |
| Readability [d] | 500 g |
| Verification unit [e] | 500 g |
| Tare range | -1500 kg |
| Max readability for non-verified scale | 200 g |
| OIML Class | III |

| | |
|---|---|
| **Physical parameters** | |
| Display | 4.3” LCD (backlit) |
| Cable length | 3 m |
| Weighing pan dimensions | 1500×1500 mm |
| Weighing platform height | 88 mm |
| Packaging dimensions W x D x H | 1600×1600×430 mm |
| Scale mass with indicator | 190 kg |
| Gross weight | 225 kg |
| **Construction** | |
| Protection class | IP 66 / 69 construction, IP 66 / 67 / 69 terminal |
| **Communication interface** | |
| Communication interface | RS232, USB |
| Optional interfaces | RS232 or RS485 or 4IN/4OUT or Ethernet or analog output 4-20 mA |
| **Electrical parameters** | |
| Power supply | 100 – 240 V AC 50/60 Hz |
| Optional power supply | internal rechargeable battery |
| Operation time on batteries | max 7h |
| **Environmental conditions** | |
| Operating temperature | -10 – +40 °C |
| Relative humidity | 10% – 85% RH no condensation |

Additional fee for verification

## Accessories (Additional Fee)

AP2-4 Current Loop Unit
RS 232 cables (scale - printer)
Ramps
Frame for embedded scales
Displays
Ethernet cables (scale - Ethernet)
RS 232, RS 485 cables
Power Adapters
RS 232 – Ethernet Converter
USB adatper
Receipt Printer
USB cable (scale - printer)
Stands, wall mounting kits and mounting brackets
RS 232 – USB Converter

## Software (Additional Fee)

• RAD Key [WX-010-0005]
• Scale Editor 2.1 [WX-010-0173]
• R-Lab [WX-010-0080]

# Device dimensions W x D x H

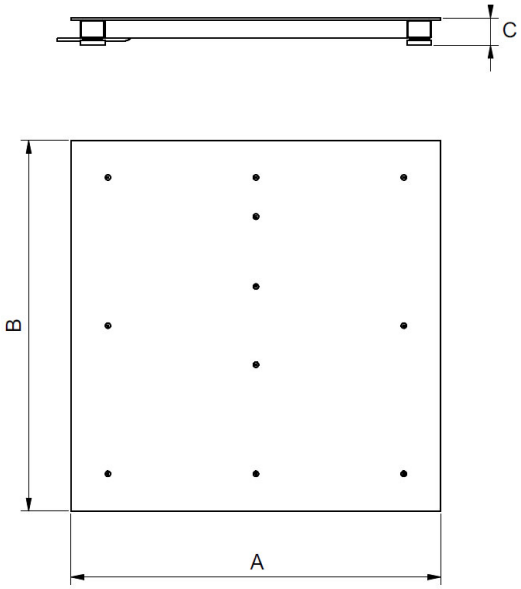


| Scale type | A [mm] | B [mm] | C [mm] |
|---|---|---|---|
| H315.4.300.H6 | 800 | 800 | 88 ±2 |
| H315.4.600.H6 | 800 | 800 | 88 ±2 |
| H315.4.300.H7 | 1000 | 1000 | 88 ±2 |
| H315.4.600.H7 | 1000 | 1000 | 88 ±2 |
| H315.4.1500.H7 | 1000 | 1000 | 88 ±2 |
| H315.4.1500.H8 | 1200 | 1200 | 88 ±2 |
| H315.4.3000.H8 | 1200 | 1200 | 111 ±2 |
| H315.4.1500.H8/9 | 1200 | 1500 | 88 ±2 |
| H315.4.3000.H8/9 | 1200 | 1500 | 111 ±2 |
| H315.4.1500.H9 | 1500 | 1500 | 88 ±2 |
| H315.4.3000.H9 | 1500 | 1500 | 111 ±2 |
| H315.4.3000.H10 | 1500 | 2000 | 111 ±2 |
| H315.4.6000.H10 | 1500 | 2000 | 166 ±2 |