radwag.com

# Palettenwaage C315.4P.600.C

WP-239-0003

More information on the website
mirror.radwag.com/de/info,w1,CB1



The drawings, photos and graphics used are for illustrative purposes only.

## Funktionen

- Plus/Minus Control
- Percent Weighing
- Totalizing
- Parts counting
- Internal battery
- Peak hold
- Newton unit measurement
- GLP Procedures
- Animal weighing
- ALIBI Memory

## Technische Daten

| Messtechnische Parameter | |
|---|---|
| Wägebereich [Max] | 600 kg |
| Min. Belastung | 4 kg |
| Ablesbarkeit [d] | 200 g |
| Eichwert [e] | 200 g |
| Tarierbereich | -600 kg |
| Max Ablesbarkeit [d] bei nicht geeichter Waage | 200 g |
| OIML-Klasse | III |

| | |
|---|---|
| **Physikalische Parameter** | |
| Display | 4,3” LCD (hinterleuchtet) |
| Kabellänge | 3 m |
| Waagschale | 840×1200 mm |
| Abmessungen des Geräts B x T x H | 1322×840×85 mm |
| Verpackungsgröße B x T x H | 1400×900×430 mm |
| Gewicht der Waage mit Messgerät | 43 kg |
| **Konstruktion** | |
| Schutzart | IP 65 Konstruktion, IP 67 Tensometer, IP 43 Terminal |
| **Kommunikationsschnittstellen** | |
| Schnittstellen | RS232 |
| Optionale Schnittstellen | RS232 |
| **Elektrische Parameter** | |
| Stromversorgung | 100 – 240 V AC 50/60 Hz + Akkus |
| Maximaler Leistungsaufnahme | 5 W |
| Akku-Betriebszeit | max 8h |
| **Umgebungsbedingungen** | |
| Umgebungstemperatur | -10 – +40 °C |
| Relative Luftfeuchtigkeit | 10% – 85% RH ohne Kondensation |





Additional fee for verification



## Zubehör (Additional Fee)

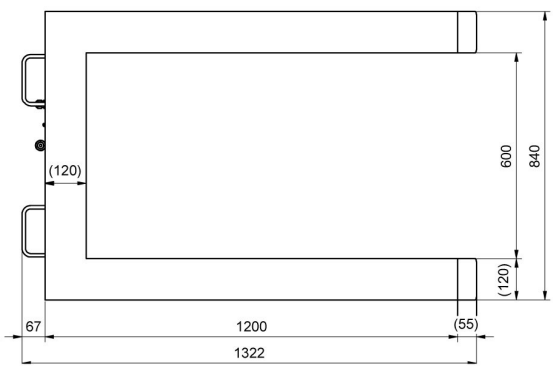
Netzteile
Kabel RS 232 (Waage – Drucker)
Wandhalterung, Stativ
Anschlusskabel für Zigarettenanzünder
Displays
Kabel RS 232, RS 485
Konverter RS 232 – Ethernet
Ausgang der Stromschnittstelle AP2-1
Konverter RS 232 – USB
Konverter RS 232 – RS 485
Thermische Drucker

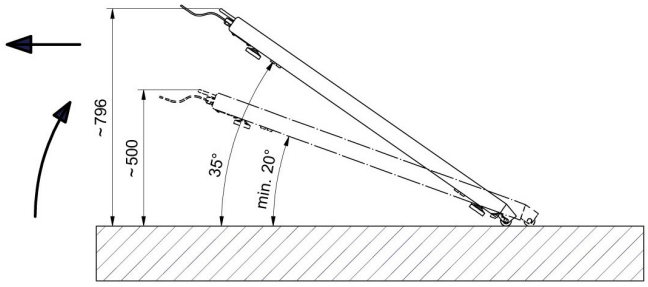
## Software (Additional Fee)

• RAD Key [WX-010-0005]
• Scale Editor 2.1 [WX-010-0173]
• RLAB [WX-010-0080]

# Abmessungen des Geräts B x T x H




Warunki transportu i przemieszczania wagi paletowej przy pomocy kółek jezdnych oraz uchwytów.

Transport of the pallet scale using casters and handles.