radwag.com

# Plataforma de pesagem C315.4.1500.C6

WP-230-0004

More information on the website
mirror.radwag.com/br/info,w1,S8F



The drawings, photos and graphics used are for illustrative purposes only.

## Funções

- Plus/Minus Control
- Percent Weighing
- Totalizing
- Parts counting
- Internal battery
- Peak hold
- Newton unit measurement
- GLP Procedures
- Animal weighing
- ALIBI Memory

## Ficha Técnica

| Parâmetros metrológicos | |
|---|---|
| Capacidade máxima [máx] | 1500 kg |
| Carga mínima | 10 kg |
| Resolução [d] | 0,5 kg |
| Unidade de verificação [e] | 0,5 kg |
| Faixa de tara | -1500 kg |
| Resolução máxima para plataforma não verificada | 100 g |
| Classe OIML | III |

| | |
|---|---|
| **Parâmetros físicos** | |
| Display | 4,3” LCD (retroiluminado) |
| Comprimento até cabo | 3 m |
| Dimensões até prato de pesagem | 800×800 mm |
| Altura da plataforma de pesagem | 120 ± 10 mm |
| Dimensões da embalagem L x P x A | 900×900×500 mm |
| Plataforma com indicador | 55 kg |
| **Construção** | |
| Classe de proteção | IP 65 construção, IP 67 célula, IP 43 terminal |
| **Interface de comunicação** | |
| Interface de comunicação | RS232 |
| Interfaces opcionais | RS232 |
| **Parâmetros elétricos** | |
| Fonte de alimentação | 100 – 240 V AC 50/60 Hz e bateria |
| Consumo de energia máx. | 5 W |
| Tempo de operação com baterias | max 8h |
| **Condições ambientais** | |
| Temperatura de operação | -10 – +40 °C |
| Umidade relativa | 10% – 85% RH sem condensação |





Additional fee for verification


# Acessórios (Additional Fee)


Adaptadores de energia
Cabos de alimentação para acendedor de cigarro automotivo
Displays
Estrutura para balanças de fosso
RS 232, RS 485 cabos
Conversor RS 232 – Ethernet
Unidade de loop de corrente AP2-1
RS 232 – Conversor USB
Cabos RS 232 (plataforma - impressora)
Conversor RS 232 – RS 485
Impressora de recibos

# Software (Additional Fee)

• RAD Key [WX-010-0005]
• R-Lab [WX-010-0080]

# Dimensões do dispositivo L x P x A

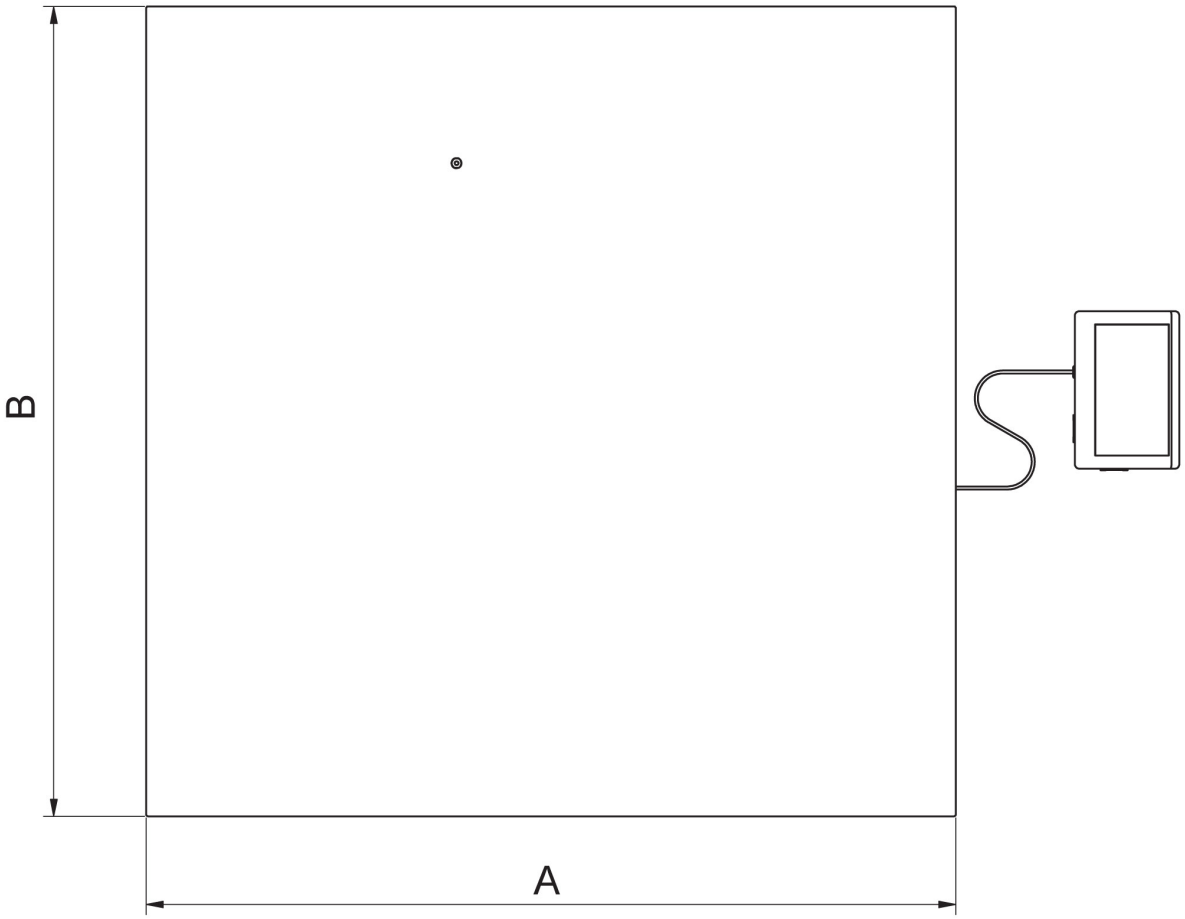


| | A | B | H |
|---|---|---|---|
| C6 | 800 | 800 | 120 ±10 |
| C7 | 1000 | 1000 | 120 ±10 |
| C8 | 1200 | 1200 | 120 ±10 |
| C8/9 | 1200 | 1500 | 120 ±10 |
| C9 | 1500 | 1500 | 120 ±10 |
| 6000.C9 | 1500 | 1500 | 160 ±10 |