



More information on the website
mirror.radwag.com/en/info,w1,83F

C315.4P2.4000.C2 Beam Scale

WP-240-0006



The drawings, photos and graphics used are for illustrative purposes only.

Functions

 Plus/Minus Control

 Percent Weighing

 Totalizing

 Parts counting

 Internal battery

 Peak hold

 Newton unit measurement

 GLP Procedures

 Animal weighing

 ALIBI Memory

Datasheet

| Metrological parameters | |
|-------------------------|----------|
| Maximum capacity [Max] | 4000 kg |
| Minimum load | 40 kg |
| Readability [d] | 2 kg |
| Verification unit [e] | 2 kg |
| Tare range | -4000 kg |
| OIML Class | III |

| Physical parameters | |
|-----------------------------|--|
| Display | 4.3" LCD (backlit) |
| Cable length | 3 m + 5 m |
| Weighing pan dimensions | 2 pcs 2.5 m |
| Device dimensions W x D x H | 2500×120×155 mm |
| Scale mass with indicator | 105 kg |
| Construction | |
| Protection class | IP 65 construction, IP 67 cell, IP 43 terminal |
| Communication interface | |
| Communication interface | RS232 |
| Optional interfaces | RS232 |
| Electrical parameters | |
| Power supply | 100 – 240 V AC 50/60 Hz and battery |
| Power consumption max. | 5 W |
| Operation time on batteries | max 8h |
| Environmental conditions | |
| Operating temperature | -10 – +40 °C |
| Relative humidity | 10% – 85% RH no condensation |



Additional fee for verification



Accessories (Additional Fee)

Power Adapters

RS 232 cables (scale - printer)

Stands, wall mounting kits and mounting brackets

Cigarette lighter receptacle power supply cables

Displays

RS 232 – Ethernet Converter

AP2-1 Current Loop Unit

RS 232, RS 485 cables

RS 232 – USB Converter

RS 232 – RS 485 Converter

Receipt Printer


Software (Additional Fee)

• RAD Key [WX-010-0005]

• Scale Editor 2.1 [WX-010-0173]

• R-Lab [WX-010-0080]

Device dimensions W x D x H

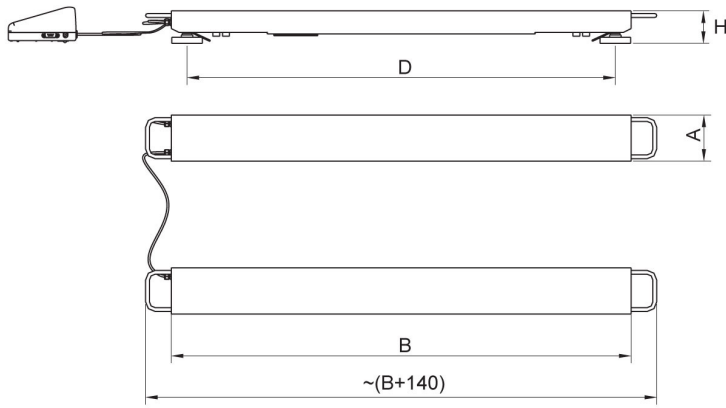

| Scale type | A | B | H | D |
|------------------|-----|------|-----|------|
| C315.4P2.600.C | 120 | 1200 | 85 | 1100 |
| C315.4P2.1500.C | 120 | 1200 | 85 | 1100 |
| C315.4P2.3000.C | 120 | 1200 | 85 | 1100 |
| C315.4P2.2000.C1 | 120 | 2000 | 105 | 1900 |
| C315.4P2.2000.C2 | 120 | 2500 | 105 | 2400 |
| C315.4P2.4000.C1 | 120 | 2000 | 155 | 1880 |
| C315.4P2.4000.C2 | 120 | 2500 | 155 | 2380 |
| C315.4P2.6000.C1 | 120 | 2000 | 155 | 1880 |
| C315.4P2.6000.C2 | 120 | 2500 | 155 | 2380 |

dimensions in mm